

**2005 - 2009 Cadillac XLR: Service Bulletin:
#07-04-95-001A: Tapping or Scraping Noise
From Rear Wheel Area (Replace Wheel Drive
Shaft Nut) - (May 29, 2008)**



**#07-04-95-001A: Tapping or Scraping Noise From
Rear Wheel Area (Replace Wheel Drive Shaft Nut) -
(May 29, 2008)**

Subject: Tapping or Scraping Noise From Rear Wheel Area (Replace
Wheel Drive Shaft Nut)

Models: 2005-2009 Cadillac XLR
2005-2009 Chevrolet Corvette

This bulletin is being revised to add the 2009 model year. Please discard
Corporate Bulletin Number 07-04-95-001 (Section 04 – Driveline/Axle).

Condition

Some customers may comment on a tapping or a scraping noise coming
from the rear wheel area.

Cause

This condition may be due to the torque on the wheel drive shaft nut
relaxing over time.

Correction

Replace the left and the right wheel drive shaft nut following the procedure below.

Remove the center cap from the rim.

Remove and discard the wheel drive shaft nut.

Apply LOCTITE™ 272, or equivalent, to the threads of the axle shaft.

Install the nut and tighten to the new specification.

Tighten

Tighten the nut to 215 Y (160 lb ft).

Install the center cap to the rim.

Important: The vehicle should not be driven for 24 hours following the repair in order to allow the thread lock to cure.

Parts Information

Part Number	Description	Qty
10257766	Nut	2 (one per side)

Online URL:

<https://www.xlr-net.com/knowledgebase/article/2005-2009-cadillac-xlr-service-bulletin-07-04-95-001a-tapping-or-scraping-noise-from-rear-wheel-area-replace-wheel-drive-shaft-nut-may-29-2008-127.html>