


**2005 - 2009 Cadillac XLR: Service Bulletin:  
#07-04-95-001A: Tapping or Scraping Noise  
From Rear Wheel Area (Replace Wheel Drive  
Shaft Nut) - (May 29, 2008)**



**#07-04-95-001A: Tapping or Scraping Noise From  
Rear Wheel Area (Replace Wheel Drive Shaft Nut) -  
(May 29, 2008)**

**Subject:** Tapping or Scraping Noise From Rear Wheel Area (Replace  
Wheel Drive Shaft Nut)

**Models:** 2005-2009 Cadillac XLR  
2005-2009 Chevrolet Corvette

This bulletin is being revised to add the 2009 model year. Please discard  
Corporate Bulletin Number 07-04-95-001 (Section 04 – Driveline/Axle).

**Condition**

Some customers may comment on a tapping or a scraping noise coming  
from the rear wheel area.

**Cause**

This condition may be due to the torque on the wheel drive shaft nut  
relaxing over time.

**Correction**

Replace the left and the right wheel drive shaft nut following the procedure below.

Remove the center cap from the rim.

Remove and discard the wheel drive shaft nut.

Apply LOCTITE™ 272, or equivalent, to the threads of the axle shaft.

Install the nut and tighten to the new specification.

Tighten

Tighten the nut to 215 Y (160 lb ft).

Install the center cap to the rim.

**Important: The vehicle should not be driven for 24 hours following the repair in order to allow the thread lock to cure.**

## Parts Information

Part Number	Description	Qty
10257766	Nut	2 (one per side)

Online URL:

<https://www.xlr-net.com/knowledgebase/article/2005-2009-cadillac-xlr-service-bulletin-07-04-95-001a-tapping-or-scraping-noise-from-rear-wheel-area-replace-wheel-drive-shaft-nut-may-29-2008-127.html>