

# 2004 - 2009 Cadillac XLR: Service Bulletin: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001

## #PIC6140B: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001 - (Dec 21, 2015)

**Subject:** Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001

**Models:** 2005-2009 Buick Allure  
2004 Buick Century  
2005-2009 Buick LaCrosse  
2000-2005 Buick LeSabre  
2004-2007 Buick Rainier  
2004 Buick Regal  
2003-2007 Buick Rendezvous  
2005-2007 Buick Terraza  
2003-2007 Cadillac CTS  
2002-2005 Cadillac Deville  
2003-2006 Cadillac Escalade  
2002-2004 Cadillac Seville  
2004-2006 Cadillac SRX  
2004-2011 Cadillac STS  
2004 - 2009 Cadillac XLR  
2003-2006 Chevrolet Avalanche  
2005-2010 Chevrolet Cobalt  
2004-2012 Chevrolet Colorado  
2005-2013 Chevrolet Corvette  
2005-2006 Chevrolet Equinox

2004-2005 Chevrolet Express  
2006-2011 Chevrolet HHR  
2001-2005 Chevrolet Impala  
2004-2012 Chevrolet Malibu  
2002-2005 Chevrolet Monte Carlo  
2003-2007 Chevrolet Silverado  
2003-2006 Chevrolet Suburban  
2003-2006 Chevrolet Tahoe  
2009-2009 Chevrolet Trailblazer  
2005-2009 Chevrolet Uplander  
2003-2005 Chevrolet Venture  
2004-2012 GMC Canyon  
2002-2009 GMC Envoy  
2003-2005 GMC Savana  
2003-2007 GMC Sierra  
2003-2006 GMC Yukon/Yukon XL  
2003-2007 Hummer H2  
2006-2011 Hummer H3  
2001-2003 Oldsmobile Aurora  
2002-2004 Oldsmobile Bravado  
2003-2004 Oldsmobile Silhouette  
2003-2005 Pontiac Aztec  
2000-2005 Pontiac Bonneville  
2007-2010 Pontiac G5  
2005-2010 Pontiac G6  
2004-2008 Pontiac Grand Prix  
2003-2009 Pontiac Montana  
2005-2006 Pontiac Pursuit  
2006-2010 Pontiac Solstice  
2004-2005 Pontiac Sunfire  
2006 Pontiac Torrent  
2005-2008 Pontiac Vibe  
2008-2009 Saturn Astra  
2007-2010 Saturn Aura

2004-2007 Saturn ION  
2003-2004 Saturn L-Series  
2005-2007 Saturn Relay  
2007-2010 Saturn Sky  
2003-2007 Saturn Vue

---

This PI has been updated to include an updated Warranty Information. Please disregard PIC6140A.

---


### **Condition/Concern**

A dealer or customer may notice a red LED and DTC B2455 setting current in the VCIM after performing Canada upgrade bulletin 15-08-44-001.

When placing calls or connecting to OnStar, the person on the other end is able to hear the caller clearly.

### **Recommendation/Instructions**



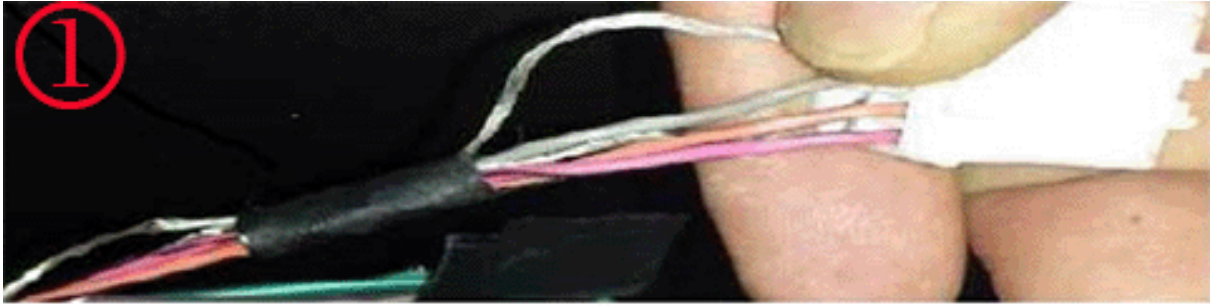

1. It has been found that a short between the audio drain wire and microphone drain wire will cause this concern.
2. Pull back the tape at X2 of the VCIM far enough to see where the bare wires are covered.
3. Tape the bare wires individually to prevent them from shorting. Then tape the harness back up.

Online URL:

<https://www.xlr-net.com/knowledgebase/article/2004-2009-cadillac-xlr-service-bulletin-red-led-and-b2455-after-performing-canada-upgrade-bulletin-15-08-44-001-7.html>